

# SERVICE BULLETIN




The 1968 Belvedere cars equipped with 426 C.I.D. Hemi engines have a six quart oil pan capacity (one extra quart when filter is changed). This is one quart more than the 1966 and 1967 426 Street Hemi engines.

It has been determined that the 1967 oil level indicator, Part No. 2806238, was used in the 1968 engines through 12-1-67. This indicator would show one quart overflow when six quarts of oil is used.

Part No. 2951255 is the correct oil level indicator for the 1968 426 Hemi. The identification and dimensions of this indicator are shown below. Please replace all indicators (dipsticks) that do not correspond.

The indicator insulator should be transferred from the original indicator, to the new indicator, or a new insulator, Part No. 2806239 should be installed, at the time of indicator replacement.

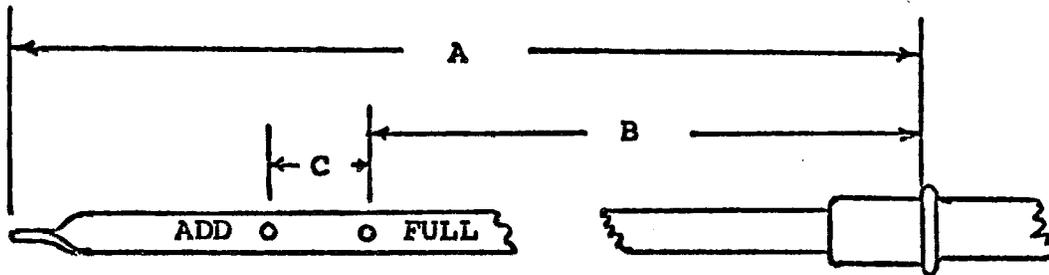

PART NO.	A	B	C	HANDLE IDENTIFICATION
2946006	20.00	17.63	.43	ORANGE INK

POLICY: INFORMATION ONLY

*J. W. Farley*  
 J. W. FARLEY  
 Manager - Service  
 CHRYSLER-PLYMOUTH DIVISION

Seq. No. 53

March 8, 1968

No. 68-9-4

ENGINE

INCORRECT  
OIL  
LEVEL  
INDICATOR

1968  
BELVEDERE  
MODELS  
EQUIPPED  
WITH  
C.I.D.  
HEMI  
ENGINE

P-980-C

Service Mgr.	
Shop Foreman	
Technicians	
Apprentice	
Parts Mgr.	
Partsmen	

THIS BULLETIN IS SUPPLIED AS TECHNICAL INFORMATION ONLY AND IS NOT AN AUTHORIZATION FOR REPAIRS

CHRYSLER-PLYMOUTH DIVISION



**CHRYSLER**  
MOTORS CORPORATION